SAFETY DATA SHEET

SECTION 1 IDENTIFICATION

Product Stock No: 5680 TURBALOY® 347 **Product Name:** Product use: Welding Wire and Rod Manufacturer's name: UNITED STATES WELDING CORPORATION


Address: 3579 HWY 50 E. #104, Carson City, NV 89701 Emergency phone: (775) 883-7878 Business phone: (775) 883-7878 Website: www.usweldingcorp.com Date of issue: 1/4/2020

SECTION 2-HAZARDS IDENTIFICATION

The article is NOT classified as dangerous according to Directive 1999/45/EC

Byproducts generated during the welding process are considered hazardous. Warning!- Avoid breathing fumes and gases, they may be dangerous to your health. Always use adequate ventilation. Always use appropriate personal protective equipment.

Primary Routes of Entry: Respiratory System, Eyes and/or Skin.

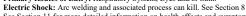

See Section 11 for more detailed information on health effects and symptoms

Arc Rays: The welding arc can injure eyes and burn skin. Fumes and Gases: Can be dangerous to your health.



SECTION 3-COMPOSITION/INFORMATION ON INGREDIENTS

SECTION 5 COM OSTIONAL ORALINATION ON MORE DENTIS				
Components	CAS No.	EC No.	Wt. %	Classification
Chromium	7440-47-3	231-157-5	20.00	Not Classified
Copper	7440-50-8	231-159-6	0.75	Not Classified
Iron	7439-89-6	231-096-4	Bal	Not Classified
Manganese	7439-96-5	231-105-1	2.00	Xn, R20/22
Molybdenum	7439-98-7	231-107-2	0.75	Not Classified
Nickel	7440-02-0	231-111-4	13.00	Carc. Cat, 3: R40, R43
Silicon	7440-21-3	231-130-8	1.00	Not Classified

The above percent concentrations are considered nominal and are provided for industrial hygiene purposes. They do not represent a certification of content.

SECTION 4 FIRST AID MEASURES

These measures apply primarily to the byproducts produced during welding.

Inhalation - For over-exposure to airborne fumes and particulate, remove exposed person to fresh air. If breathing is difficult or has stopped, administer artificial respiration or oxygen as indicated. Seek medical attention promptly.

Skin - Remove contaminated clothing. Wash affected areas with soap or mild detergent and water. If thermal burn has occurred, flush area with cold water and seek medical attention. If mechanical abrasion has occurred, seek medical attention.

Eve - To remove dusts or fumes flush with water for at least fifteen minutes. If irritation persists, obtain medical assistance. For radiation burns due to arc flash, see physician,

Ingestion - While Ingestion is not a likely route of exposure for these products. If swallowed call physician immediately! Do not induce vomiting unless directed by medical personnel. Never give fluids or induce vomiting if person is unconscious, having convulsions, or not breathing.

SECTION 5 FIRE-FIGHTING MEASURES

Welding consumables applicable to this sheet as shipped are nonreactive, nonflammable, non explosive and essentially nonhazardous until welded, Welding arcs and sparks can ignite combustibles and flammable products. Unused welding consumables may remain hot for a period of time after completion of a welding process. See American National Standard (ANSI) Z49.1 for further general safety information on the use and handling of welding consumables and associated procedures

Fire-Fighting Equipment: Wear a self-contained breathing apparatus (SCBA) with a full face-piece operated in pressure-demand or positive-pressure mode and full protective clothing.

SECTION 6 ACCIDENTAL RELEASE MEASURES

As shipped this product does not pose a hazard to the environment.

SECTION 7 HANDLING AND STORAGE

HANDLING: No specific requirements in the form supplied. Handle with care to avoid cuts. Wear gloves when handling welding consumables. Avoid exposure to dust. Do not ingest. Some individuals can develop an allergic reaction to certain materials. Retain all warning and product labels. STORAGE: Keep separate from acids and strong bases to prevent possible chemical reactions

SECTION 8 EXPOSURE CONTROLS/PERSONAL PROTECTION

Components	OSHA PEL (mg/m3)	ACGIH (mg/m3)	
Aluminum	15mg/m3 (Total metal dust) 5 mg/m3 (Metal dust – respirable fraction)	10 mg/m3)Metal dust) 5 mg/m3 (Welding fumes)	
Beryllium	0.002 mg/m3, 0.005 mg/m3 (ceiling), 0.025 mg/m3 (water soluble)	0.002 mg/m3	
Chromium *	1.0 mg/m3 (Metal as Cr)	0.5 mg/m3	
Cobalt	0.05 mg/m3 (As Co metal)	0.05 mg/m3 (Dust & fume as Co)	
Copper	1 mg/m3 (Dust & mists, as Cu), 0.1 mg/m3 (Fumes as Cu)	1 mg/m3 (Dust & mists, as Cu), 0.2 mg/m3 (Fumes)	
Iron	No limit set (For Fe2O3 dust & fumes the PEL is 10 mg/m3 as Fe	No limit set (For Fe2O3 fume the TLV is 5 mg/m3 as Fe	
Manganese	5 mg/m ³ (Ceiling, as Mn compounds); 1 mg/m ³ (Fume, as Mn); STEL 3 mg/m ³ (Fume as Mn)	5 mg/m ³ (Dust & compounds, as Mn); 1 mg/m ³ (Fume, as Mn); STEL 3 mg/m ³	
		(Fume as Mn)	
Molybdenum	10 mg/m ³ (Insoluble compounds, total dust as Mo)	mg/m ³ (Insoluble compounds, as Mo)	
Nickel	1 mg/m ³ for metal and insoluble compounds as Ni	1 mg/m ³ as metal	
Silicon	10 mg/m ³ Total dust; 5 mg/m ³ Respirable fraction	10 mg/m ³	
Titanium	No limit set	No limit set	
Tungsten	5 mg/m ³ insoluble compounds, as W; STEL 10 mg/m ³ for insoluble compounds, as W		

SECTION 8 CONTINUED	I			
Addition Information:	* A portion of metallic chromium may be converted during the welding process to hexavalent chromium. Hexavalent chromium is classified as an IARC Group 1 Carcinogenic. NTP			
Monitoring Procedures:	classifies hexavalent chromium as Known to be Carcinogenic. If this product contains ingredients with exposure limits, personal, workplace atmosphere or biological monitoring may be determine the effectiveness of ventilation or other control			
5	measures and/or the necessity to use respiratory protective equipment. Reference should be made to European Standard EN689 for methods for the assessment of exposure by			
Ventilation:	inhalation to chemical agents and national guidance documents for methods for the determination of hazardous substances. Use process enclosures, local ventilation or other engineering controls to keep airborne levels below recommended exposure limits. If user operations generate dust, fumes or mist, use			
Description - Destantion	ventilation to keep exposure to airborne contaminates below the exposure limits.			
Respiratory Protection:	Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels the hazards of the product and the safe working limits of the selected respirator.			
Hand Protection:	Gloves should be worn to minimize contact. During the welding process, heat insulated gloves are recommended.			
Eye Protection: Skin Protection:	Safety glasses or goggles are recommended when handling this material. During the welding process, safety goggles and dark lenses must be worn. Personal protective equipment for the body should be selected based on the task being performed and the risk involved and should be approved by a specialist before handling this			
	product.			
Hearing Protection:	During the welding process, the operator and other personal close to the welding operation must be protected from excessive noise. Hearing protection that meets local standards should be used.			
Hygiene Measures:	Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period, appropriate techniques			
should be used to rem	nove potentially contaminated clothing. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.			
This section applies primarily to the w	IT I			
Physical State: Wire or rod.				
Color: Metallic. Odor: Oderless				
Ouor. Odeness				
Vapor Pressure: Not applicable	Water Solubility: Insoluble Boiling Point: Not applicable le Viscosity: Not applicable Evaporation Rate: Not applicable			
Vapor Density (Air=1): Not applicable Density: ~8 gm/cc	le Viscosity: Not applicable Evaporation Rate: Not applicable Melting Point: ~2350 °F pH: Not applicable			
	SECTION 10 STABILITY AND REACTIVITY			
	cable to this sheet are solid and nonvolatile as shipped. This product is only intended for use per the welding parameters it was designed for. When this product is used for welding,			
hazardous tumes may be created. Oth The amount of fume varies with the w	er factors to consider include the base metal. base metal preparation and base metal coating. All of these factors can can contribute to the fume and gases generated during welding. elding parameters.			
Stability: This product is stable under	normal conditions. Reactivity: Contact with acids or strong bases may cause generation of gas. SECTION 11 TOXICOLOGICAL INFORMATION			
SHORT-TERM (ACUTE) OVERE)	SECTION IT TOATCOLOGICAL INFORMATION XPOSURE EFFECTS: Welding Fumes – May result in discomfort such as dizziness, nausea or dryness or irritation of nose, throat or eves. Aluminum Oxide – Irritation of the			
respiratory system. Chromium - Inha	lation of fumes with chromium (VI) compounds can cause irritation of the respiratory tract, lung damage and asthma-like symptoms. Swallowing chromium (VI) salts can cause severe			
	ulcers. Eyes may be burned by chromium (VI) compounds. Allergic reactions may occur in some people. Iron, Iron Oxide – None are known. Treat as nuisance dust or fume. verexposure to the oxide may cause metal fume fever characterized by metallic taste, tightness of chest and fever. Symptoms may last 24 to 48 hours following overexposure. Manganese			
	verexposure to the oxide may cause metal runne rever characterized by metalice taster, dignness of chest and rever. Symptonis may tast 24 to 46 nours following overexposure. Managemeter hills, Every upset stomach, vomiting, irritation of the throat and aching of body. Recovery is generally complete within 48 hours of the overexposure. Molydenum – Irritation of the			
	npounds – Metallic taste, nausea, tightness in chest, metal fume fever, allergic reaction. Titanium Dioxide – Irritation of respiratory system.			
	EXPOSURE EFFECTS: Welding Fumes – Excess levels may cause bronchial asthma, lung fibrosis, pneumoconiosis or "siderosis". Aluminum Oxide - Pulmonary fibrosis and and perforation of nasal septum. Respiratory irritation may occur with symptoms resembling asthma. Studies have shown that chromate production workers exposed to hexavalent			
	and performance or mean septement receptually in manufacture and approved the skin than chromiting utilities and the and the sector and the sector and the sector and the skin than chromiting utilities and the sector			
	Iron, Iron Oxide Fumes - Can cause siderosis (deposits of iron in lungs) which some researchers believe may affect pulmonary functions. Lungs will clear in time when exposure to iron			
	agnetite (Fe3O4) are not regarded as fibrogenic materials, Magnesium. Magnesium Oxide – No adverse long term health effects have been reported in the literature. Manganese – e compounds may affect the central nervous system. Symptoms may be similar to Parkinson's disease and can include slowness, changes in handwriting, gait impairment, muscle spasms			
	compounds may inter the contract retrieves who are overexposed to manganese compounds should be seen by a physician for early detection of neurotracing part impounds, nueve oparations or and behavioral changes. Employees who are overexposed to manganese compounds should be seen by a physician for early detection of neurotracing part impounds. Overexposure to			
manganese and manganese compound	s above safe exposure limits can cause irreversible damage to the nervous system, including the brain, symptoms of which may include slurred speech, lethargy, tremor, muscular			
	and spastic gait. Molybdenum – Prolonged overexposure may result in loss of appetite, weight loss, loss of muscle coordination, difficulty in breathing and anemia. Nickel, Nickel noconiosis. Studies of nickel refinery workers indicated a higher incidence of lung and nasal cancers. Titanium Dioxide – Pulmonary irritation and slight fibrosis.			
	AVATED BY EXPOSURE: Persons with pre-existing impaired lung functions (asthma-like conditions). Frammer Dovide – Functionary inflation and again movies. VATED BY EXPOSURE: Persons with pre-existing impaired lung functions (asthma-like conditions).			
until they have consulted their doctor	and obtained information from the manufacturer of the device. Respirators are to be worn only after being medically cleared by your company-designated physician.			
	VI compounds, nickel compounds are classified as IARC Group 1 and NTP Group K carcinogens. Titanium dioxide compounds are classified as IARC Group 2B carcinogens, Chromium d welding fumes must be considered as carcinogens under OSHA (29 CFR 1910-1200).			
	TION 65: WARNING: THIS PRODUCT CONTAINS A CHEMICAL KNOWN TO THE STATE OF CALIFORNIA TO CAUSE			
	EFECTS (OR OTHER REPRODUCTIVE HARM).			
	SECTION 12 ECOLOGICAL INFORMATION			
	directly to the environment. Welding wire can degrade if left outside and unprotected. Residues from welding consumables and processes could degrade and accumulate in the soil and			
groundwater.	SECTION 13 DISPOSAL CONSIDERATION			
Use recycling procedures if available.	Discard any product, residue, packaging, disposable container or liner in an environmentally acceptable manner, in full compliance with Federal, State and local regulations.			
	SECTION 14 TRANSPORT INFORMATION			
Not international regulations or restric	tions are applicable. No special precautions are necessary.			
This information applies to the wire as	SECTION 15 REGULATORY INFORMATION			
SARA Section 313 Supplier Notificati				
The product covered by this MSDS may contain the following toxic chemicals subject to the reporting requirements of Section 313 of the Emergency Planning and Community Right-To-Know act of 1986 and of 40 DFR				
372: Beryllium, Chromium, Copper, Manganese and Nickel. Refer to Section 3 of the MSDS for percentage of each element by weight and CAS number. Risk Phrases: R40- Limited evidence of a carcinogenic effect.				
	42/43: May cause sensitization BY INHALATION AND SKIN CONTACT.			
	115- Contact with water liberates extremely flammable gases.			
ĸ	10- Flammable			
	22- Do not breathe dust.			
	24- Avoid contact with skin 37- Wear suitable protective gloves			
Product Use: Cl	lassification and labeling have been performed according to EU Directives 67/548/EEC and 1999/45/EC (including amendments) and the intended use.			
Industrial Application: U	sed by welding			
SECTION 16 OTHER INFORMATION				
For additional information please refer USA: American National Star	r to the following sources: ndard (ANSI) Z49.1 "Safety in Welding and Cutting", ANSI/American Welding Society (AWS) F1.5 "Methods for Sampling and Analyzing Gases from Welding and Allied			
Processes", ANSI/AWS F1.1 "Method for Sampling Airborne Particles Generated by Welding and Allied Processes", AWSF3.2M/F3.2 Ventilation Guide for Weld Fume", American Welding Society, 550				
North Le Jeune Road, Miami, Florida, 33135. Safety and Health Fact Sheets available from AWS at www.aws.org OSHA Publication 2206 (29 C.F.R. 1910), U.S. Government Printing Office, Superintendent of Documents, P. O. Box 371954, Pittsburgh, PA. 15250-7954.				
	ox 371954, Pittsburgh, PA. 15250-7954. es and Biological Exposure Indices, American Conference of Governmental Hygienists (ACGIH), 6500 Glenway Ave., Cincinnati, Ohio 45211, USA. NFPA 51B "Standard for Fire			
Prevention During Wel	ding, Cutting and Other Hot Work" published by the National Fire Protection Association, 1 Batterymarch Park, Quincy, MA 02169.			
	and 237, "Hazards from Welding Fume", The arc welder at work, some general aspects of health and safety:.			
NOTICE				
To the best of our knowledge the information herein is accurate. However, United States Welding Corp. does not assume liability whatsoever for the accuracy or completeness of the information contained herein.				
Final Determination of Suitability o	f any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described			
herein, we cannot guarantee that the				